



# SERVICE BULLETIN

**BULLETIN: 04-06**

**DATE: 4/12/2006**

**SUBJECT: 42C AFT SALON WINDOW BREAKAGE**

**HULL #s: STNAF259E506 through STNAF272A606**


There is a possibility that some screws were incorrectly installed in the aft bulkhead of the 42 Convertibles described above. The boats listed **MUST** be inspected to determine if the screws are there and removed if found. **FAILURE** to remove the screws will result in breakage of the glass in the aft bulkhead. Follow the instructions to determine if the screws are present.

1. Remove the track for the aft entry door drape as shown in photo 1.
2. Remove the two screws as shown in photo 2 and set aside the headliner panel.
3. Remove the screw securing the entry door track to the bulkhead directly over the aft window.
4. Inspect for the three screws behind the aluminum entry door track and remove if there.
5. Reinstall the screw to secure the door track.
6. Reinstall the headliner panel.

3 hours labor will be paid for this inspection/repair

Submit a warranty claim for this job on a separate claim using the problem code 1405 "SERVICE BULLETINS".

Picture 1

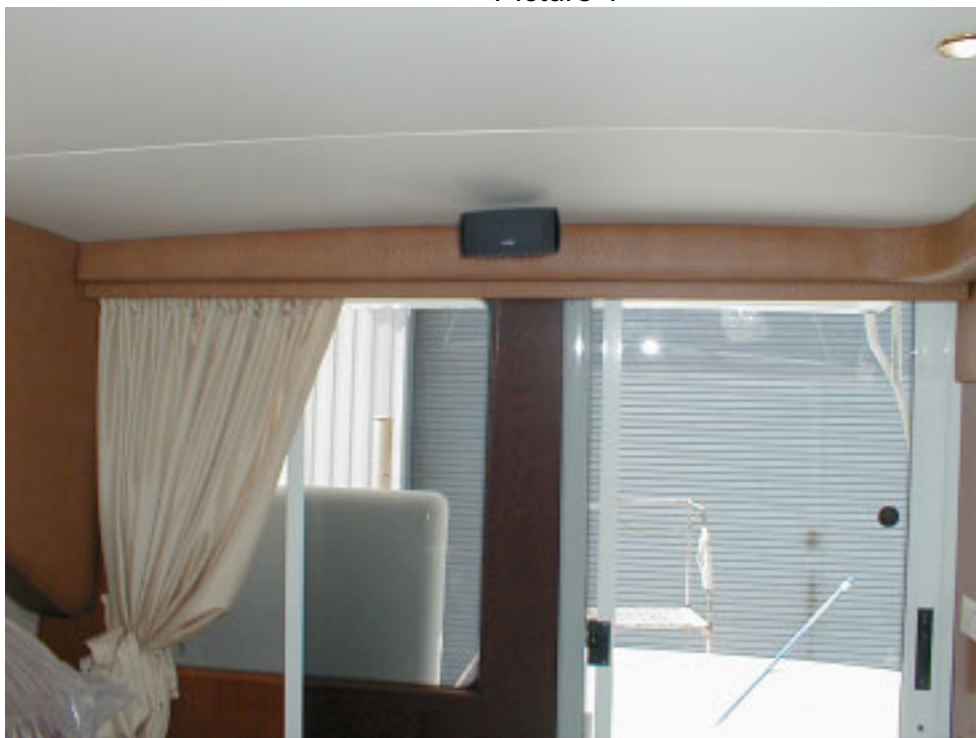

Picture 2

