



**SILVERTON**

MARINE CORPORATION AN EMPLOYEE OWNERSHIP COMPANY

## SERVICE BULLETIN

**BULLETIN # 03-03**

**DATE: 5/13/03**

**SUBJECT: 42 CONVERTIBLE STEERING CLEVIS PINS**

**HULL #s: #31 THRU #170**


It has come to our attention that the steering clevis pins on certain 42 convertibles have shown excessive wear. Because this system has a large affect on the handling and performance of the boat we recommend the following repairs be done as soon as possible.

The original brass clevis pins need to be replaced by a new stainless steel clevis pin with a nylon bushing. All parts should be ordered thru the customer service department.

Silverton will pay 1 hour labor to make this repair. We at Silverton apologize for any inconvenience.

Parts consist of.

- 2 ea. Stainless clevis pins
- 2 ea. Nylon bushings
- 2 ea. 1 ¼ X 1/8" Cotter pin

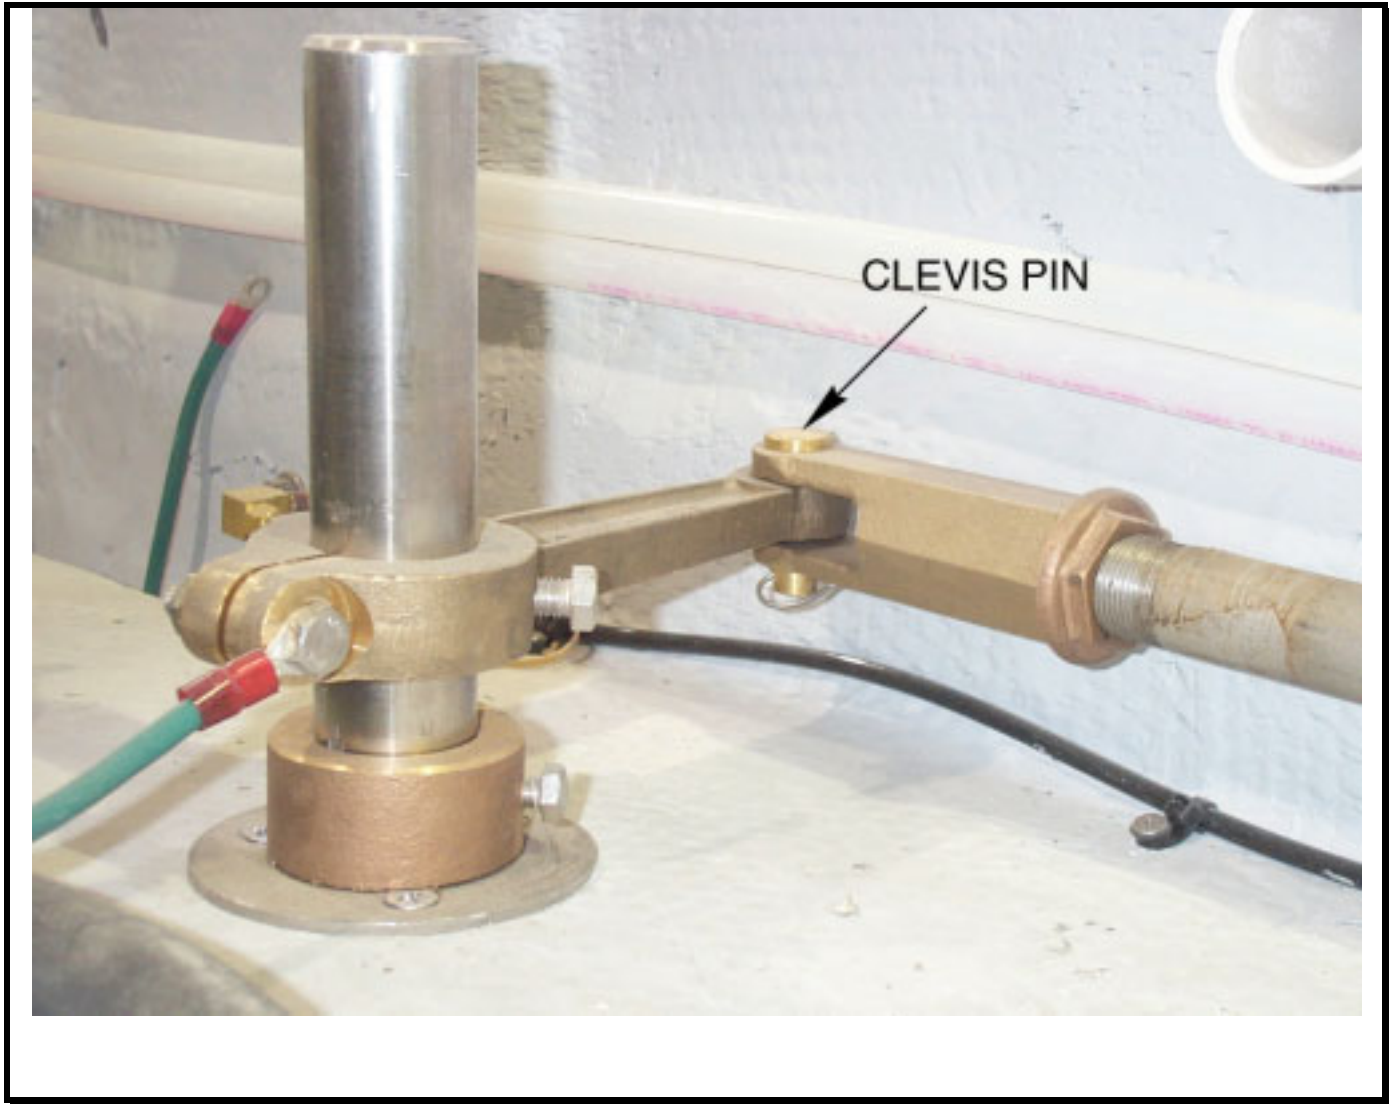

CLEVIS PIN

