



SILVERTON

MARINE CORPORATION AN EMPLOYEE OWNERSHIP COMPANY

SERVICE BULLETIN

BULLETIN: 02-06

DATE: 9/12/2005


SUBJECT: 43SB GALLEY AIR CONDITIONING DUCT HOSE

HULL #s:

It has recently been brought to Silverton's attention when installing the mid air conditioning unit, the duct hose running to the galley may have been crushed.

To correct this problem, follow instructions below.

- 1- Remove air condition hatch located in the STBD. Mid state room.
- 2- Remove galley duct hose from air cond. unit and pull duct hose through into galley floor compartment. (See photo below)
- 3- With a jigsaw ob-long hole where duct hose passed through bulkhead so duct hose is inline with plenum box on air cond. unit. (See photo below) (Before cutting hole be certain that there are no hose or wires in area to be cut and the blade on saw will not hit the AC unit.)
- 4- Pass duct hose back through hole and re-attach to AC unit.

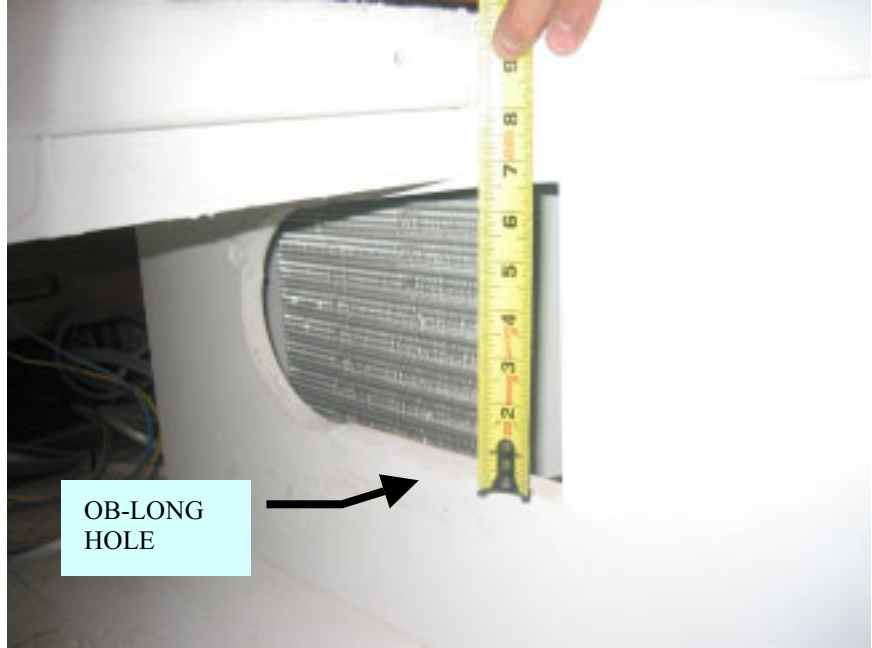

OB-LONG
HOLE



GALLEY
DUCT
HOSE